

Civil Aviation Authority

EMERGENCY MANDATORY PERMIT DIRECTIVE



Number: 2016-003-E Issue date: 22 June 2016

In accordance with Article 22(1) of The Air Navigation Order 2009, as amended, the following action required by this Mandatory Permit Directive (MPD) is mandatory for applicable aircraft registered in the United Kingdom operating on a UK CAA Permit to Fly.

Type Approval Holder's Name:		Type/Model Designation(s):
P&M Aviation Ltd		Pegasus Quik
Title:	Wing - Top Rigging Clevis Pin – Split Ring Replacement	
Manufacturer:	P&M Aviation Ltd	
Applicability:	Pegasus Quik aircraft with Manual Luffline Trim System	
Reason:	An incident occurred to a Pegasus Quik in flight when the split ring securing the clevis pin attaching the top rear rigging came out in flight. The free end of the top rear rigging cable was caught by the propeller which pulled it violently sideways, damaging the sail. The aircraft was landed safely.	
	have a spiral start whand those which hav	of split rings which may be fitted, those which nich may allow the ring to climb out and detach, e a 90 degree bend giving a positive stop. The o an aircraft with the spiral start split ring.
Effective Date:	23 June 2016	
Compliance/Action:	Compliance is requir	ed as follows, unless previously accomplished:
	of the top gear riggin	replace the split rings in the clevis pins at each end g with the specified split pins in accordance with ervice Bulletin Number SB 139.
ENSURE COMPLIAN	CE WITH THIS MPD IS	S RECORDED IN THE AIRCRAFT LOGBOOK
Reference Publications:	P & M Aviation Lt 21 June 2016.	d Service Bulletin Number 139, Issue 1, dated
Remarks:	This MPD was r of the requireme	not posted for consultation because of the urgency nt.
Remarks:	or the requireme	
Remarks:	2. Enquiries regard referred to: GA	ding this Mandatory Permit Directive should be Unit, Civil Aviation Authority, Safety and Airspace up, Aviation House, Gatwick Airport South, West R.